

Manhole Inspection Summary

Manhole # S05CC_014MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **05CC** Node: **014** Status: **Found**

Insp Date: **3/6/08 1:52 PM**

Incomplete Comments

Crew: **BCCB**
Inspector: **Chung**
Firm: **URS**

Location Address: **4130 MOUNTWOOD RD**

Cross Street: **MOUNTWOOD
GLENHUNT ALLEY**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **Sheeting**

Comments

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **5** (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged
Shape: **Circular** Diameter: **48** (in.) Length: (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged
Channel Exposure: **Closed** Junc Dist: **0** nearest .5 ft. Azimuth:
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**


Steps Count: **5** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View




DEBRIS: CONE IN MANHOLE

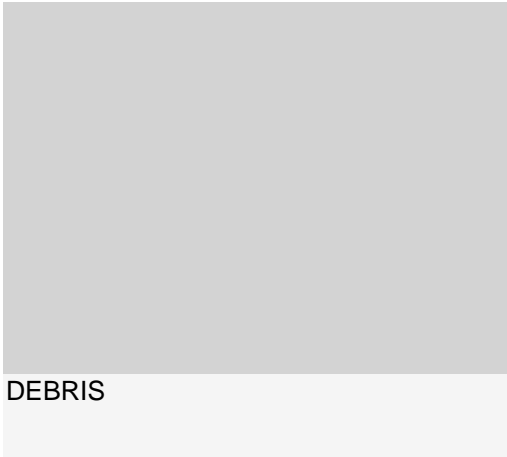

DEBRIS

Top View

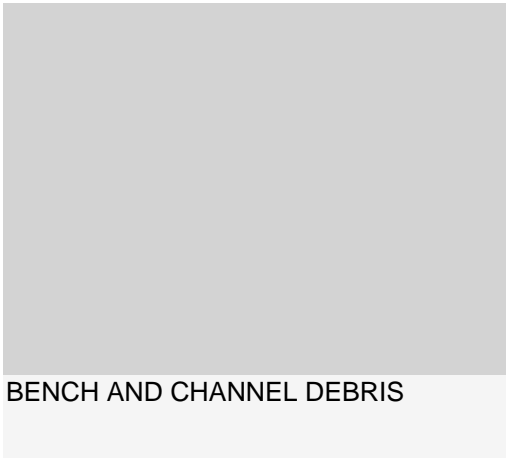


BENCH AND CHANNEL DEBRIS

GRADE ADJUSTMENT



Defect 1

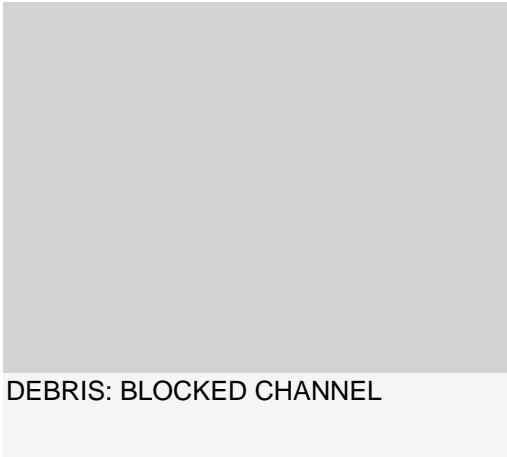

DEBRIS: BLOCKED CHANNEL

Manhole Inspection Summary

Manhole # S05CC_014MH

Printed On: 6/24/2010

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



PIPE DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.50** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ **Grassy** ☐ **Debris** ☒ **Grease**

Silt Depth: **2** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 4 O'Clock

4 O'Clock Inflow



PIPE DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.30** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ **Mud** ☒ **Grassy** ☒ **Debris** ☐ **Grease**

Silt Depth: **8** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection